United States
Environmental Protection
Agency

Office of Water
Washington, D.C.

EPA 832-F-99-019
September 1999

EPA

Storm Water Technology Fact Sheet

Infiltration Trench

United States Environmental Protection Agency
Office of Water Washington, D.C.
EPA 832-F-99-019
September 1999

EPA

Storm Water Technology Fact Sheet
Infiltration Trench

DESCRIPTION

Urban development is significantly increasing surface runoff and contamination of local watersheds. As a result, infiltration practices, such as infiltration trenches, are being employed to remove suspended solids, particulate pollutants, coliform bacteria, organics, and some soluble forms of metals and nutrients from storm water runoff. As shown in Figure 1, an infiltration trench is an excavated trench, 0.9 to 3.7 meters (3 to 12 feet) deep, backfilled with a stone aggregate, and lined with filter fabric. A small portion of the runoff, usually the first flush, is diverted to the infiltration

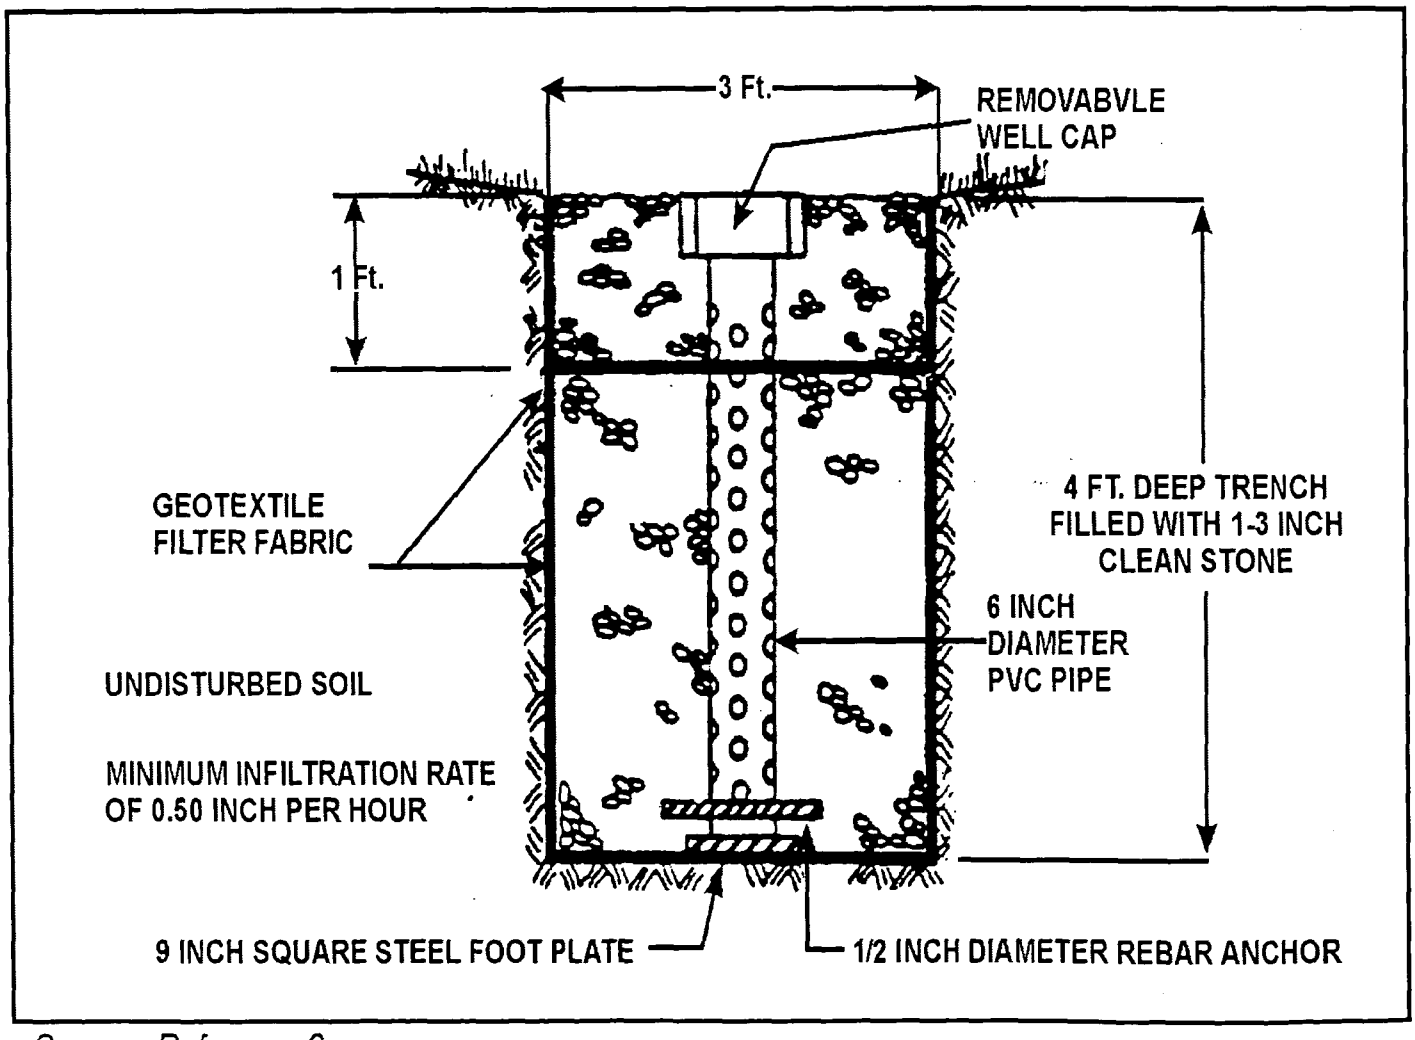

Source: Reference 6
Source: Southeastern Wisconsin Regional Planning Commission, 1991.

FIGURE 1 TYPICAL INFILTRATION TRENCH

trench, which is located either underground or at grade. Pollutants are filtered out of the runoff as it infiltrates the surrounding soils. Infiltration trenches also provide groundwater recharge and preserve baseflow in nearby streams.

APPLICABILITY

Infiltration trenches are often used in place of other Best Management Practices where limited land is available. Infiltration trenches are most widely used in warmer, less arid regions of the U.S. However, recent studies conducted in Maryland and New Jersey on trench performance and operation and maintenance have demonstrated the applicability of infiltration trenches in colder climates if surface icing is avoided (Lindsey, et al, 1991).

Infiltration trenches capture and treat small amounts of runoff, but do not control peak hydraulic flows. Infiltration trenches may be used in conjunction with another Best Management Practice (BMP), such as a detention pond, to provide both water quality control and peak flow control (Harrington, 1989). Figure 2 is an example of such a combined technology. This type of infiltration trench has a concentrated input, as opposed to dispersed input (as shown in Figure 1). This system stores the entire storm water volume with the water quality (BMP) volume connected to the infiltration system. This is commonly achieved with a slow release of the storm water management volume through an orifice set at a specified level in the storage facility. As a result the BMP water quality volume will equal the storm water detention area below the orifice level which must infiltrate to exit.

Runoff that contains high levels of sediments or hydrocarbons (oil and grease) that may clog the trench are often pretreated with other BMPs. Examples of some pretreatment BMPs include grit chambers, water quality inlets, sediment traps, swales, and vegetated filter strips (SEWRPC, 1991, Harrington, 1989).

ADVANTAGES AND DISADVANTAGES

Infiltration trenches provide efficient removal of suspended solids, particulate pollutants, coliform bacteria, organics and some soluble forms of metals and nutrients from storm water runoff. The captured runoff infiltrates the surrounding soils and increases groundwater recharge and baseflow in nearby streams.

Negative impacts include the potential for groundwater contamination and a high likelihood of early failure if not properly maintained.

As with any infiltration BMP, the potential for groundwater contamination must be carefully considered, especially if the groundwater is used for human consumption or agricultural purposes. The infiltration trench is not suitable for sites that use or store chemicals or hazardous materials unless hazardous and toxic materials are prevented from entering the trench. In these areas, other BMPs that do not interact with the groundwater should be considered. The potential for spills can be minimized by aggressive pollution prevention measures. Many municipalities and industries have developed comprehensive spill prevention control and countermeasure (SPCC) plans. These plans should be modified to include the infiltration trench and the contributing drainage area. For example, diversion structures can be used to prevent spills from entering the infiltration trench.

Because of the potential to contaminate groundwater, extensive site investigation must be undertaken early in the site planning process to establish site suitability for the installation of an infiltration trench. The use of infiltration trenches may be limited by a number of factors, including type of native soils, climate, and location of groundwater tables. Site characteristics, such as excessive slope of the drainage area, fine-particled soil types, and proximate location of the water table and bedrock, may preclude the use of infiltration trenches. The slope of the surrounding area should be such that the runoff is evenly distributed in sheet flow as it enters the trench unless specifically designed for concentrated input. Generally, infiltration trenches are not suitable for areas with relatively impermeable soils containing clay and silt

or in areas with fill. The trench should be located well above the water table so that the runoff can filter through the trench and into the surrounding soils and eventually into the groundwater. In addition, the drainage area should not convey heavy levels of sediments or hydrocarbons to the trench. For this reason, trenches serving parking lots must be preceded by appropriate pretreatment such as an oil-grit separator. This measure will make effective maintenance feasible. Generally, trenches that are constructed under parking lots must provide access for maintenance.

An additional limitation on use of infiltration trenches is the climate. In cold climates, the trench surface may freeze, thereby preventing the runoff from entering the trench and allowing the untreated runoff to enter surface water. The surrounding soils may also freeze, reducing infiltration into the soils and groundwater. However, recent studies indicate that if properly designed and maintained, infiltration trenches can operate effectively in colder climates. By keeping the trench surface free of compacted snow and ice, and by ensuring that part of the trench is constructed below the frost line, the performance of the infiltration trench during cold weather will be greatly improved.

Finally, there have been a number of concerns raised about the long term effectiveness of infiltration trench systems. In the past, infiltration trenches have demonstrated a relatively short life span, with over 50 percent of the systems checked having partially or completely failed after 5 years. A recent study of infiltration trenches in Maryland (Lindsey et al., 1991) found that 53 percent were not operating as designed, 36 percent were partially or totally clogged, and another 22 percent exhibited slow filtration. Longevity can be increased by careful geotechnical evaluation prior to construction and by designing and implementing an inspection and maintenance plan. Soil infiltration rates and the water table depth should be evaluated to ensure that conditions are satisfactory for proper operation of an infiltration trench. Pretreatment structures, such as a vegetated buffer strip or water quality inlet, can increase longevity by removing sediments, hydrocarbons, and other materials that may clog the trench. Regular maintenance, including the replacement of clogged aggregate, will also increase the effectiveness and life of the trench.

DESIGN CRITERIA

Prior to trench construction, a review of the design plans may be required by state and local governments. The design plans should include a geotechnical evaluation that determines the feasibility of using an infiltration trench at the site. Soils should have a low silt and clay content and have infiltration rates greater than 1.3 centimeters (0.5 inches) per hour. Acceptable soil texture classes include sand, loamy sand, sandy loam and loam. These soils are within the A or B hydrologic group. Soils in the C or D hydrologic groups should be avoided. Soil survey reports published by the Soil Conservation Service can be used to identify soil types and infiltration rates. However, sufficient soil borings should always be taken to verify site conditions. Feasible sites should have a minimum of 1.2 meters (4 feet) to bedrock in order to reduce excavation costs. There should also be at least 1.2 meters (4 feet) below the trench to the water table to prevent potential ground water problems. Trenches should also be located at least 30.5 meters (100 feet) upgradient from water supply wells and 30.5 meters (100 feet) from building foundations. Land availability, the depth to bedrock, and the depth to the water table will determine whether the infiltration trench is located underground or at grade. Underground trenches receive runoff through pipes or channels, whereas surface trenches collect sheet flow from the drainage area.

In general, infiltration trenches are suitable for drainage areas up to 4 hectares (10 acres) (SEWRPC, 1991, Harrington, 1989). However, when the drainage area exceeds 2 hectares (5 acres), other BMPs should be carefully considered. The drainage area must be fully developed and stabilized with vegetation before constructing an infiltration trench. High sediment loads from unstabilized areas will quickly clog the infiltration trench. Runoff from unstabilized areas should be diverted away from the trench into a construction BMP until vegetation is established.

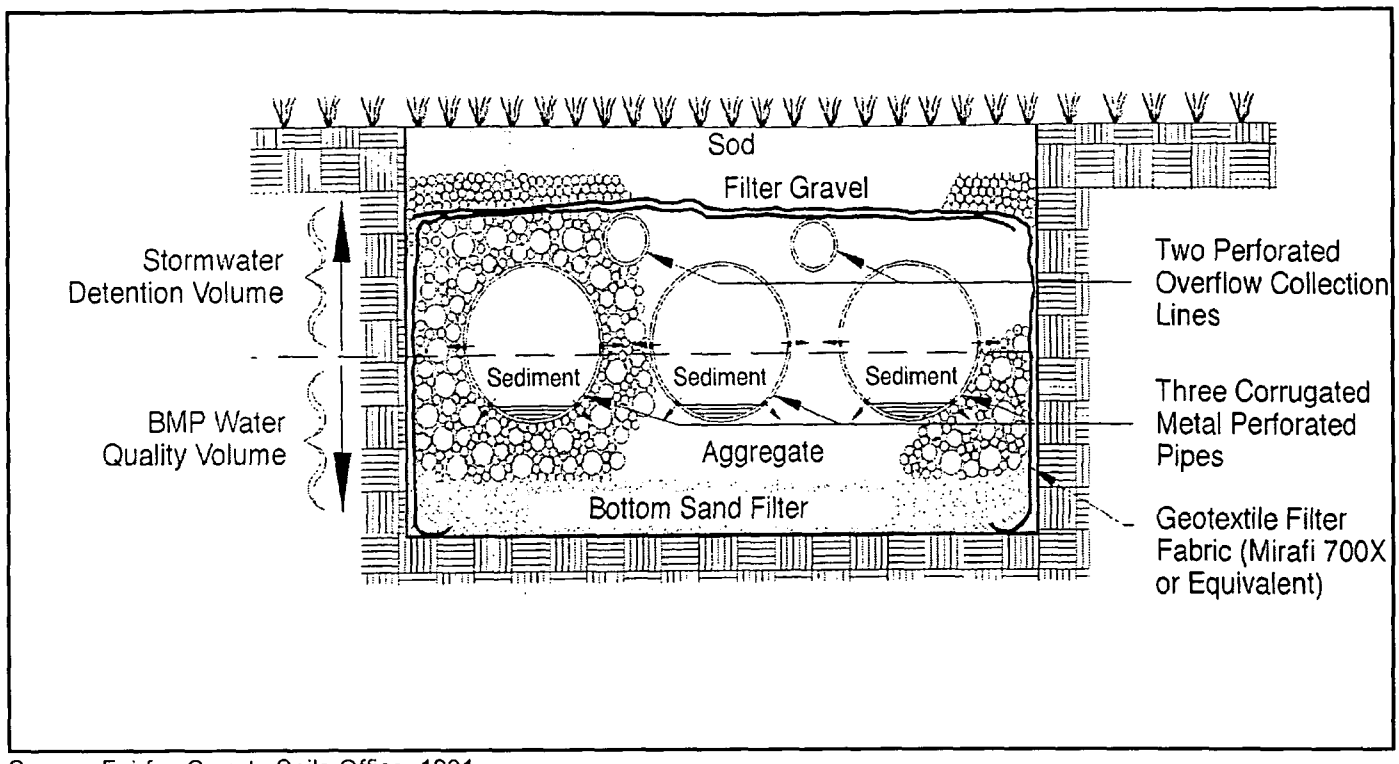

Source: Fairfax County Soils Office, 1991.

FIGURE 2 INFILTRATION TRENCH WITH CONCENTRATED INPUT AND AUGMENTED PIPE STORAGE

The drainage area slope determines the velocity of the runoff and also influences the amount of pollutants entrained in the runoff. Infiltration trenches work best when the upgradient drainage area slope is less than 5 percent (SEWRPC, 1991). The downgradient slope should be no greater than 20 percent to minimize slope failure and seepage.

The trench surface may consist of stone or vegetation with inlets to evenly distribute the runoff entering the trench (SEWRPC, 1991, Harrington, 1989). Runoff can be captured by depressing the trench surface or by placing a berm at the down gradient side of the trench.

The basic infiltration trench design utilizes stone aggregate in the top of the trench to promote filtration; however, this design can be modified by substituting pea gravel for stone aggregate in the top 0.3 meter (1 foot) of the trench. The pea gravel improves sediment filtering and maximizes the pollutant removal in the top of the trench. When the modified trenches become clogged, they can generally be restored to full performance by removing and replacing only the pea gravel layer, without replacing the lower stone aggregate layers.

Infiltration trenches can also be modified by adding a layer of organic material (peat) or loam to the trench subsoil. This modification appears to enhance the removal of metals and nutrients through adsorption. The trenches are then covered with an impermeable geotextile membrane overlain with topsoil and grass (Figure 2).

A vegetated buffer strip (6.1 to 7.6 meters, or 20-25 feet, wide) should be established adjacent to the infiltration trench to capture large sediment particles in the runoff. The buffer strip should be installed immediately after trench construction using sod instead of hydroseeding (Schueler, 1987). The buffer strip should be graded with a slope between 0.5 and 15 percent so that runoff enters the trench as sheet flow. If runoff is piped or channeled to the trench, a level spreader must be installed to create sheet flow (Harrington, 1989).

During excavation and trench construction, only light equipment such as backhoes or wheel and ladder type trenchers should be used to minimize compaction of the surrounding soils. Filter fabric should be placed around the walls and bottom of the trench and 0.3 meters (1 foot) below the trench

surface. The filter fabric should overlap each side of the trench in order to cover the top of the stone aggregate layer (see Figure 1). The filter fabric prevents sediment in the runoff and soil particles from the sides of the trench from clogging the aggregate. Filter fabric that is placed 0.3 meters (1 foot) below the trench surface will maximize pollutant removal within the top layer of the trench and decrease the pollutant loading to the trench bottom, reducing frequency of maintenance.

The required trench volume can be determined by several methods. One method calculates the volume based on capture of the first flush, which is defined as the first 1.3 centimeters (0.5 inches) of runoff from the contributing drainage area (SEWRPC, 1991). The State of Maryland (MD., 1986) also recommends sizing the trench based on the first flush, but defines first flush as the first 1.3 centimeters (0.5 inches) from the contributing impervious area. The Metropolitan Washington Council of Governments (MWCOG) suggests that the trench volume be based on the first 1.3 centimeters (0.5 inches) per impervious acre or the runoff produced from a 6.4 centimeter (2.5 inch) storm. In Washington D.C., the capture of 1.3 centimeters (0.5 inches) per impervious acre accounts for 40 to 50 percent of the annual storm runoff volume. The runoff not captured by the infiltration trench should be bypassed to another BMP (Harrington, 1989) if treatment of the entire runoff from the site is desired.

Trench depths are usually between 0.9 and 3.7 meters (3 and 12 feet) (SEWRPC, 1991, Harrington, 1989). However, a depth of 2.4 meters (8 feet) is most commonly used (Schueler, 1987). A site specific trench depth can be calculated based on the soil infiltration rate, aggregate void space, and the trench storage time (Harrington, 1989). The stone aggregate used in the trench is normally 2.5 to 7.6 centimeters (1 to 3 inches) in diameter, which provides a void space of 40 percent (SEWRPC, 1991, Harrington, 1989, Schueler, 1987).

A minimum drainage time of 6 hours should be provided to ensure satisfactory pollutant removal in the infiltration trench (Schueler, 1987, SEWRPC, 1991). Although trenches may be designed to provide temporary storage of storm water, the trench should drain prior to the next storm event. The drainage time will vary by precipitation zone. In the Washington, D.C. area, infiltration trenches are designed to drain within 72 hours.

An observation well is recommended to monitor water levels in the trench. The well can be a 10.2 to 15.2 centimeter (4 to 6 inch) diameter PVC pipe, which is anchored vertically to a foot plate at the bottom of the trench as shown in Figure 1 above. Inadequate drainage may indicate the need for maintenance.

PERFORMANCE

Infiltration trenches function similarly to rapid infiltration systems that are used in wastewater treatment. Estimated pollutant removal efficiencies from wastewater treatment performance and modeling studies are shown in Table 1.

Based on this data, infiltration trenches can be expected to remove up to 90 percent of sediments, metals, coliform bacteria and organic matter, and up to 60 percent of phosphorus and nitrogen in the runoff (Schueler, 1992). Biochemical oxygen demand (BOD) removal is estimated to be between 70 to 80 percent. Lower removal rates for nitrate, chlorides and soluble metals should be expected,

TABLE 1 TYPICAL POLLUTANT REMOVAL EFFICIENCY

Pollutant	Typical Percent Removal Rates
Sediment	90%
Total Phosphorous	60%
Total Nitrogen	60%
Metals	90%
Bacteria	90%
Organics	90%
Biochemical Oxygen Demand	70-80%

Source: Schueler, 1992.

especially in sandy soils (Schueler, 1992).

Pollutant removal efficiencies may be improved by using washed aggregate and adding organic matter and loam to the subsoil. The stone aggregate should be washed to remove dirt and fines before placement in the trench. The addition of organic material and loam to the trench subsoil will enhance metals and nutrient removal through adsorption.

OPERATION AND MAINTENANCE

Infiltration, as with all BMPs, must have routine inspection and maintenance designed into the life performance of the facility. Maintenance should be performed as indicated by these routine inspections. The principal maintenance objective is to prevent clogging, which may lead to trench failure. Infiltration trenches and any pretreatment BMPs should be inspected after large storm events and any accumulated debris or material removed. A more thorough inspection of the trench should be conducted at least annually. Annual inspection should include monitoring of the observation well to confirm that the trench is draining within the specified time. Trenches with filter fabric should be inspected for sediment deposits by removing a small section of the top layer. If inspection indicates that the trench is partially or completely clogged, it should be restored to its design condition.

When vegetated buffer strips are used, they should be inspected for erosion or other damage after each major storm event. The vegetated buffer strip should have healthy grass that is routinely mowed. Trash, grass clippings and other debris should be removed from the trench perimeter and should be disposed properly. Trees and other large vegetation adjacent to the trench should also be removed to prevent damage to the trench.

COSTS

Construction costs include clearing, excavation, placement of the filter fabric and stone, installation of the monitoring well, and establishment of a vegetated buffer strip. Additional costs include planning, geotechnical evaluation, engineering and permitting. The Southeastern Wisconsin Regional Planning Commission (SEWRPC, 1991) has developed cost curves and tables for infiltration trenches based on 1989 dollars. The 1993 construction cost for a relatively large infiltration trench (i.e., 1.8 meters (6 feet) deep and 1.2 meters (4 feet) wide with a 68 cubic meter (2,400 cubic feet) volume) ranges from $8,000 to $19,000. A smaller infiltration trench (i.e., 0.9 meters (3 feet) deep and 1.2 meters (4 feet) wide with a 34 cubic meter (1,200 cubic feet) volume) is estimated to cost from $3,000 to $8,500.

Maintenance costs include buffer strip maintenance and trench inspection and rehabilitation. SEWRPC (1991) has also developed maintenance costs for infiltration trenches. Based on the above examples, annual operation and maintenance costs would average $700 for the large trench and $325 for the small trench. Typically, annual maintenance costs are approximately 5 to 10 percent of the capital cost (Schueler, 1987). Trench rehabilitation, may be required every 5 to 15 years. Cost for rehabilitation will vary depending on site conditions and the degree of clogging. Estimated rehabilitation costs run from 15 to 20 percent of the original capital cost (SEWRPC, 1991).

REFERENCES

1. Fugill, R., 1991-1992. Fairfax County Soil Science Office. Personal communication with Lauren Fillmore, Parsons Engineering Science, Inc.

2. Harrington, B.W., 1989. *Design and Construction of Infiltration Trenches in Design of Urban Runoff Quality Control.* American Society of Civil Engineers.

3. Lindsey, G., L. Roberts, and W. Page, 1991. *Storm Water Management Infiltration.* Maryland Department of the Environment, Sediment and Storm Water Administration.

4. Maryland Department of Natural Resources, 1986. *Minimum Water Quality Objectives and Planning Guidelines for Infiltration Practices.* Water Resources Administration, Sediment and Storm Water Division.

5. Northern Virginia Planning District Commission (NVPDC) and Engineers and Surveyors Institute, 1992. *Northern Virginia BMP Handbook: A Guide to Planning and Designing Best Management Practices in Northern Virginia.*

6. Schueler, T.R., 1987. *Controlling Urban Runoff: A Practical Manual for Planning and Designing Urban Best Management Practices.* Metropolitan Washington Council of Governments.

7. Schueler, T.R., 1992. *A Current Assessment of Urban Best Management Practices.* Metropolitan Washington Council of Governments.

8. Southeastern Wisconsin Regional Planning Commission (SEWRPC), 1991. *Costs of Urban Nonpoint Source Water Pollution Control Measures.* Technical Report No. 31.

9. U. S. EPA, 1991. *Detention and Retention Effects on Groundwater*, Region V.

10. Washington, State of, 1992. *Storm Water Management Manual for the Puget Sound Basin* (The Technical Manual), Department of Ecology.

ADDITIONAL INFORMATION

City of Alexandria, Virginia
Warren Bell
Department of Transportation and Environmental Services
P.O. Box 178
Alexandria, VA 22313

Carroll County, Maryland
Martin Covington
Bureau of Developmental Review
225 North Center Street
Westminster, MD 21157-5194

King County, Washington
Dave Hancock
Department of Natural Resources, Water and Land Resources Division, Drainage Services Section
700 5th Avenue, Suite 2200
Seattle, WA 98104

Montgomery County, Maryland
Rick Brush
Department of Permitting Services, Water Resource Section
250 Hungerford Drive, Suite 175
Rockville, MD 20850

Southeastern Wisconsin Regional Planning Commission
Bob Biebel
916 N. East Avenue, P.O. Box 1607
Waukesha, WI 53187

The mention of trade names or commercial products does not constitute endorsement or recommendation for the use by the U.S. Environmental Protection Agency.

For more information contact:

Municipal Technology Branch
U.S. EPA
Mail Code 4204
401 M St., S.W.
Washington, D.C., 20460

OWM MTB
Excellence in compliance through optimal technical solutions
MUNICIPAL TECHNOLOGY BRANCH